
CHANGES:
UPDATE OF BEARINGS AND RADIALS.

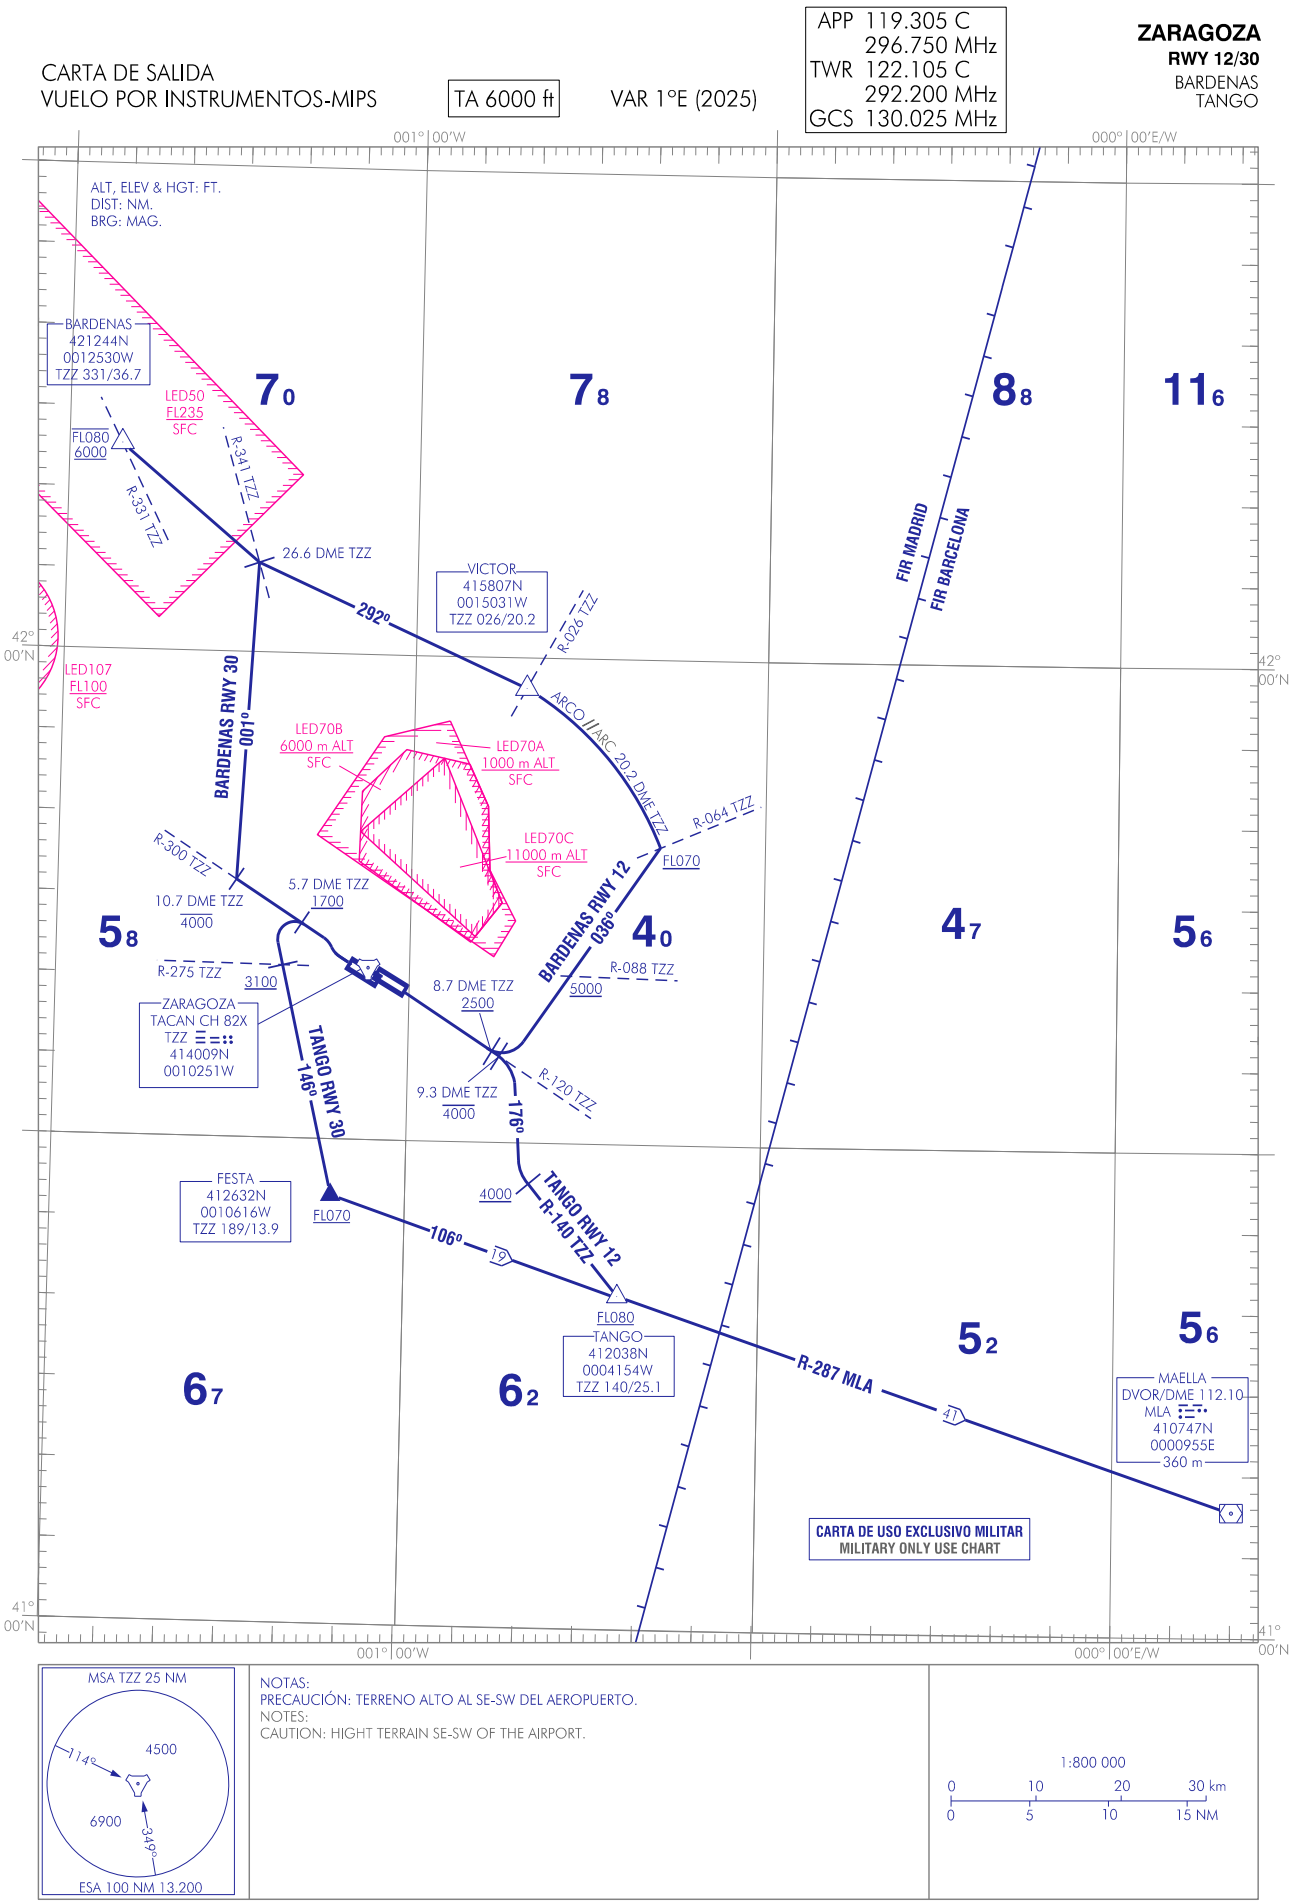

INSTRUMENT DEPARTURES (DEP) - MIPS

RUNWAY 12

BARDENAS DEPARTURE

Climb on R-120 TZZ to cross 9.3 DME TZZ at 4000 ft or below. Turn left to follow magnetic heading 036°, to cross R-088 TZZ at 5000 ft or above, to intercept arc 20.2 DME TZZ at FL070 or above (R-064 TZZ). Proceed on arc 20.2 DME TZZ to VICTOR, turn right to follow magnetic heading 292° to intercept R-341/26.6 DME TZZ, direct to BARDENAS.

Note: Over BARDENAS between 6000 ft ALT and FL080, maximum speed 280 kt.

FIX BARDENAS: R-331/36.7 DME TZZ.

TANGO DEPARTURE

Climb on R-120 TZZ to cross 8.7 DME TZZ at 2500 ft or above. Turn right to follow magnetic heading 176° to intercept R-140 TZZ, at 4000 ft or above, direct to cross TANGO at FL080 or above. Turn left to follow R-287 MLA direct to DVOR/DME MLA.

RUNWAY 30

BARDENAS DEPARTURE

Climb on R-300 TZZ to cross 10.7 DME TZZ at 4000 ft or below. Turn right to follow magnetic heading 001° to intercept R-341/26.6 DME TZZ, at assigned altitude or level, turn left direct to BARDENAS.

Note: Over BARDENAS between 6000 ft ALT and FL080, maximum speed 280 kt.

FIX BARDENAS: R-331/36.7 DME TZZ.

TANGO DEPARTURE

Climb on R-300 TZZ to cross 5.7 DME TZZ at 1700 ft or above. Turn left to follow magnetic heading 146°, cross R-275 TZZ at 3100 ft or above, direct to cross FESTA (R-189/13.9 DME TZZ) at FL070 or above. Follow magnetic heading 106° direct to cross TANGO at FL080 or above. Follow R-287 MLA direct to DVOR/DME MLA.