

LEAS AD 2 AERODROME DATA

LEAS AD 2.1 AERODROME LOCATION INDICATOR AND NAME

LEAS - ASTURIAS

LEAS AD 2.2 AERODROME GEOGRAPHICAL AND ADMINISTRATIVE DATA

1	ARP	433349N 0060205W. See AD 2-LEAS ADC.
2	Distance and direction from the city	13 km W.
3	Elevation	127 m / 416 ft.
4	Geoid undulation	52.73 ± 0.05 m (1).
5	Reference temperature	22°C.
6	Low average temperature	8°C.
7	Magnetic variation	0° (2025).
8	Annual change	10.4' E.
9	AD administration	Aena.
10	Address	Aeropuerto de Asturias; 33459 Santiago del Monte (Castrillón) Asturias.
11	TEL	+34-985 127 500
12	FAX	+34-985 127 516
13	AFTN	LEAS
14	E-mail	operaciones_ovd@aena.es
15	Approved traffic	IFR/VFR.
16	Remarks	(1) For all AD points.

LEAS AD 2.3 OPERATIONAL HOURS

1	Airport	V: 0440-2330, PS 1 HR PPR 1 HR BFR AD CLSD. I: 0540-2315, PS 1 HR AND 30 MIN PPR 1 HR BFR AD CLSD.
2	Customs and Immigration	HR AD (1).
3	Health and Sanitation	See GEN 1.4.
4	AIS	H24 (2).
5	ARO	H24 (3).
6	MET briefing	HR AD PS 55 MIN BFR HR AD.
7	ATS	V: 0425-2350, PS 1 HR PPR 1 HR BFR AD CLSD. I: 0525-2335, PS 1 HR AND 30 MIN PPR 1 HR BFR AD CLSD

8	Fuelling	V: 0410-2330, PS 1 HR PPR BFR AD CLSD. I: 0510-2315, PS 1 HR AND 30 MIN PPR BFR AD CLSD.
9	Handling	HR AD.
10	Security	H24.
11	De-icing	No.
12	Remarks	(1) With the exception of scheduled commercial flights and prior to submitting the flight plan (FPL), it is mandatory to notify the Airport Operations Office at least 3 HR before the flight. In case of operations between the start of HR AD and HR AD + 3 HR, notification must be sent by 2200 of the previous day, to the following addresses: • TEL: +34-985 127 531; +34-985 127 532 • Email: operaciones_ovd@aena.es (2) Centralised AIO Office - International NOTAM Office: • TEL: +34-913 213 137 / 138 • E-mail: unof@enaire.es (3)  Centralised ARO Office - Geographical Area 1 • TEL: +34-918 603 556; +34-672 344 412 (only for communications contingency) • E-mail: arocentralizada@enaire.es • AFTN Address for Flight Plan management LEAS: LEASZPZX

LEAS AD 2.4 HANDLING SERVICES AND FACILITIES

1	Cargo facilities	Up to 10000 kg.
2	Fuel types	100LL, JET A-1 (1).
3	Oil types	AEROSHELL W100.
4	Refuelling capacity	• 100LL: • 1 truck 3000 L, 1.7 L/s. • 1 truck 10000 L, 6.0 L/s. JET A-1: • 1 truck 30500 L, 13.5 L/s. • 1 truck 32000 L, 16.5 L/s. • 1 truck 29500 L, 35.0 L/s.
5	De-icing facilities	No.
6	Hangar space	No.
7	Repair facilities	No.

8	Remarks	• (1) TEL: +34-985 127 583 • FAX: +34-985 543 878 • E-mail: ovd@exolum.com It is compulsory to hire ground handling services for all operations, including non-commercial ones. During arrival operations, passengers and cabin crew shall wait on board the aircraft for ground handling staff to arrive. At the very least, a Category 5 apron, aircraft assistance, must be hired. Additionally, whenever there are passengers whose arrival or destination is a NON-SCHENGEN airport, Category 2, passenger assistance, must be hired. Exemptions: State, hospital, SAR, military, humanitarian and fire-fighting flights. • Ramp agents: Both for Commercial and General and Executive Aviation: • SOUTH ◦ TEL: +34-985 127 603 / 525; +34-636 911 074 ◦ E-mail: ovdkp@iberia.es ◦ SITA: OVDKPIB / OVDKQIB • AVIAPARTNER ◦ TEL: +34-652 907 609 ◦ E-mail: ovd.ops@aviapartner.aero ◦ SITA: OVDAOXH / OVDAPXH • Only for General and Executive Aviation: • UNITED AVIATION SERVICES ◦ TEL: +34-913 936 775; +34-608 916 070 ◦ FAX: +34-913 936 894 ◦ E-mail: ops@unitedaviation.es ◦ SITA: MADSPCR
---	---------	--

LEAS AD 2.5 PASSENGER FACILITIES

1	Hotels	No.
2	Restaurant	Yes.
3	Transportation	Taxis, hire cars, buses.
4	Medical facilities	No.
5	Bank/Post Office	Cash dispenser / No.
6	Tourist information	Yes.
7	Remarks	None.

LEAS AD 2.6 RESCUE AND FIREFIGHTING SERVICES

1	Fire category	7. (1)
2	Rescue equipment	In accordance with the fire category published.
3	Removal of disabled aircraft	Local companies, response time: regular hours: 120 min; during night-time hours and public holidays: undefined (response times are subject to variation depending on the time of the request). MAX ACFT that can be moved: code letter E ACFT. (2)

4	Remarks	(1) 8 on request, according to procedure (see item 20). (2) Person responsible for coordinating aircraft transfer operations: Operations Officer / Service executive. Contact via the airport Operations Office: • TEL: +34-985 127 531; +34-985 127 532 • FAX: +34-985 545 109 • E-mail: operaciones_ovd@aena.es
---	---------	--

LEAS AD 2.7 RUNWAY SURFACE CONDITION ASSESSMENT AND REPORTING, AND SNOW PLAN

1	Types of clearing equipment	Snowplough with 4 m snowplough blade and 5 m3 urea spreader incorporated.
2	Clearance priorities	Runway, TWY C, A, PRKG 02, 03 and 04, apron service road and rest of stands.
3	Use of material for movement area surface treatment	Urea (UREA).
4	Specially prepared winter runways	Not applicable.
5	Remarks	Period of application of snow plan: 01-DEC to 28/29-FEB. Runway surface condition assessment and reporting in accordance with the Global Reporting Format (GRF) methodology described in AD 1.2.2. Aerodrome in service during all seasons of the year.

LEAS AD 2.8 APRONS, TAXIWAYS AND CHECK LOCATIONS/POSITIONS DATA

1	Apron	Surface: Concrete. Strength: • PRKG 01 and 02: PCN 81/R/B/W/T. • PRKG 03, 04 and 05: PCN 148/R/C/W/T. • PRKG 06, 07 and 08A: PCN 58/R/A/W/T. • PRKG 08 and AG PCN 70/R/A/W/T.
2	Taxiways	Width: 23 m; EXC A: 32.5 m. Surface: Asphalt. Strength: • T from THR 29 up to A: PCN 128 F/A/W/T; • T from A up to runway-holding position T-2: PCN 76/F/A/W/T; • A, C, D, T from runway-holding position T-2 up to THR 11: PCN 129 F/A/W/T; • B: PCN 119 F/A/W/T.
3	Check locations	Altimeter: Apron ELEV 128 m / 420 ft. VOR: No. INS: See ADC.
4	Remarks	TWY centre line: see INSIGNIA and Data Set.

LEAS AD 2.9 SURFACE MOVEMENT GUIDANCE AND CONTROL SYSTEM AND MARKINGS

1	Taxiing guidance system	Horizontal marking, runway-holding position, intermediate holding position, stop bars, lights of intermediate holding position, lighted boards, NO ENTRY signs, runway guard lights, NO-ENTRY bar in TWY D, stands.
2	RWY markings	Designators, threshold, centre line, aiming point, side stripe and touchdown zone. (1)

3	TWY markings	Centre line and side stripe.
4	Remarks	(1) The lengths of the TDZ on RWY 29 up to 600 m.

LEAS AD 2.10 AERODROME OBSTACLES

1	Obstacles which penetrate Approach, Take-Off Climb, Conical, Inner Horizontal, Transitional, Inner Transitional and Balked Landing Surfaces established in ICAO Annex 14; and the areas 2A and 3 established in ICAO Annex 15. Those penetrating these surfaces are identified in the CSV file as “Relevante_Relevant = Si/Yes”.	See Item 10 and Data Set.
2	Remarks	See AD 2-LEAS AOC.

LEAS AD 2.11 METEOROLOGICAL INFORMATION PROVIDED


1	MET office	Asturias EMAe.
2	HR	HR AD PS 55 MIN BFR HR AD. Outside this schedule, a half-hourly METAR AUTO will be issued.
3	METAR	Half-hourly.
4	TAF	24 HR.
5	TREND	Yes.
6	Briefing	In person and by telephone.
7	Flight documentation/Language	Charts and plain language/Spanish.
8	Charts	Significant, forecast at altitude (wind and temperature) and maximum wind maps.
9	Supplementary equipment	Cloud images, lightning and radar information display.
10	ATS unit served	TWR, APP.
11	Additional information	Santander OMAe (LESD): H24 - TEL: +34-942 392 464 - Asturias EMAe: HR AD - TEL: +34-985 127 566
12	Remarks	Aerodrome climatological summary available. Aerodrome warnings available.

LEAS AD 2.12 RUNWAY PHYSICAL CHARACTERISTICS

RWY	Direction	DIM (m)	THR PSN	THR ELEV TDZ ELEV	SWY (m)	CWY (m)	Strip (m)	OFZ	RESA (m)	RWY/SWY SFC PCN
11	108.03° GEO 108° MAG	2205 x 45	433359.90N 0060251.33W	THR: 122 m / 399 ft TDZ: No	No	150 x 150	2325 x 280 (1)	No	90 x 90	RWY: ASPH PCN 110/F/A/W/T (2) SWY: No
29	288.05° GEO 288° MAG	2205 x 45	433337.79N 0060117.94W	THR: 121.7 m / 399 ft TDZ: 126.2 m / 414 ft	No	120 x 150	2325 x 280 (1)	Yes	90 x 90	RWY: ASPH PCN 110/F/A/W/T (2) SWY: No

RWY	Direction	DIM (m)	THR PSN	THR ELEV TDZ ELEV	SWY (m)	CWY (m)	Strip (m)	OFZ	RESA (m)	RWY/SWY SFC PCN
Remarks: (1) Irregular strip layout at the beginning of RWY 11. (See AD 2-LEAS ADC). (2) First 150 m from THR 11 and first 135 m from THR 29: PCN 66/F/A/W/T.										

12.1 PROFILE

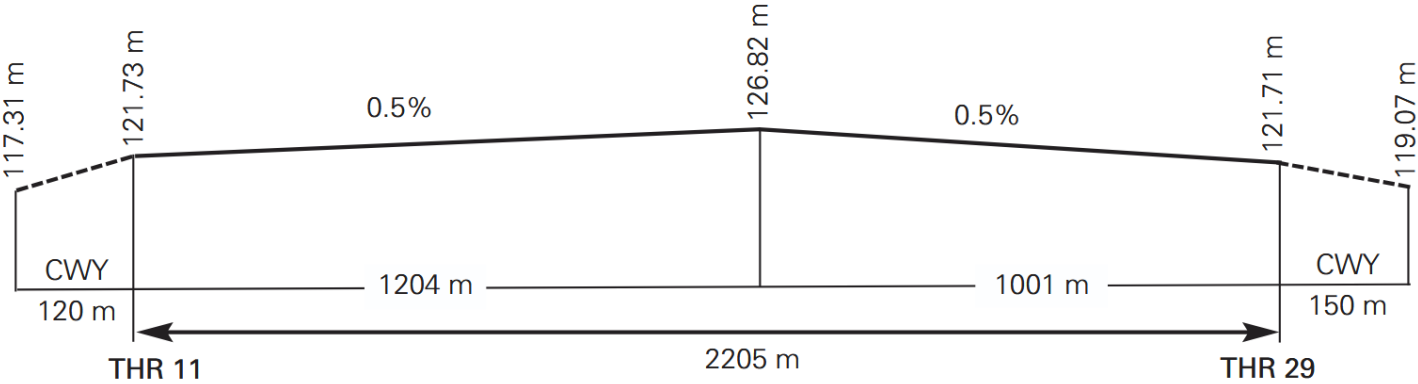

LEAS AD 2.13 DECLARED DISTANCES

RWY	TORA (m)	TODA (m)	ASDA (m)	LDA (m)
11	2205	2355	2205	2205
29	2205	2325	2205	2205
11 INT C	845	995	845	-
29 INT C	1383	1503	1383	-
Remarks: None.				

LEAS AD 2.14 APPROACH AND RUNWAY LIGHTING

1	Runway	11
2	Approach	Threshold identification lights.
3	PAPI (MEHT)	3° (15.98 m / 52 ft). (1)
4	Threshold	Green with wing bar.
5	Touchdown zone	No.
6	Runway centre line	2205 m: 1305 m white + 600 m white and red + 300 m red. LIH. Distance between lights: 15 m.
7	Runway edge	2205 m: 1605 m white + 600 m yellow. LIH Distance between lights: 50 m.
8	Runway end	Red.
9	Stopway	No.
10	Remarks	LED lighting. (1) PAPI not usable for code letter E aircraft.

1	Runway	29
2	Approach	Precision CAT II/III, 420 m. LIH.
3	PAPI (MEHT)	3° (15.45 m / 51 ft). (1)
4	Threshold	Green with wing bar.
5	Touchdown zone	900 m white.
6	Runway centre line	2205 m: 1305 m white + 600 m white and red + 300 m red. LIH. Distance between lights: 15 m.
7	Runway edge	2205 m: 1605 m white + 600 m yellow. LIH. Distance between lights: 50 m.
8	Runway end	Red.
9	Stopway	No.
10	Remarks	LED lighting. Rapid exit taxiway indicator lights (D). (1) PAPI not usable for code letter E aircraft.

LEAS AD 2.15 OTHER LIGHTING, SECONDARY POWER SUPPLY

1	ABN/IBN	No.
2	WDI	1 near THR 11, 1 near THR 29, 1 near TWY C. LGTD.
3	TWY lighting	Centre line.
4	Apron lighting	With floodlights.
5	Secondary power supply	CAT II/III, according to Annex 14.
6	Remarks	LED lighting. Retroreflective markers on TWY edge and apron edge. Radio control equipment for visual aids switch on and brightness selection. OPR AVBL 120.505 MHz and when the aerodrome is closed. Please inform security at TEL: +34-985 127 520 in case of use.

LEAS AD 2.16 HELICOPTER LANDING AREA

1	Position	• Geoid undulation: See item 2. • FATO: RWY 11/29: Coordinates THR 11 and THR 29, see item 12; • Ground taxiing: TLOF same as RWY 11/29. Coordinates THR 11 and THR 29, see item 12; • Air taxiing: TLOF same as PRKG AG.
2	Elevation	• FATO: RWY 11/29: Elevation THR 11 & THR 29, see item 12; • Ground taxiing: TLOF same as RWY 11/29. Elevation same as ARP, see item 2. • Air taxiing: TLOF same as PRKG AG. See item 8.
3	Dimensions, surface, maximum weight, marking	• FATO: RWY 11/29: see item 12; • Ground taxiing: TLOF same as RWY 11/29. Surface and strength, see item 12; • Air taxiing: TLOF same as PRKG AG. Surface and strength, see item 8.

4	Direction	See item 12.
5	Declared distances	See item 13.
6	Lighting	See items 14 and 15.
7	Remarks	See item 20 for local regulations.

LEAS AD 2.17 AIR TRAFFIC SERVICES AIRSPACE

1	Designation	CTR ASTURIAS.
2	Lateral limits	Airspace within the line joining the following points: 434008.0N 0061515.0W; 433252.0N 0054013.0W; 432623.0N 0054259.0W; 432623.0N 0055139.0W; 433457.0N 0061724.0W; 434008.0N 0061515.0W.
3	Vertical limits	SFC-3000 ft AMSL.
4	Airspace class	D.
5	Unit Language	ASTURIAS TWR. ES/EN.
6	Transition altitude	1850 m/6000 ft.
7	Hours of applicability	-
8	Remarks	None.

1	Designation	ATZ ASTURIAS.
2	Lateral limits	Circle radius 8 km centred on ARP. (1)
3	Vertical limits	SFC-3000 ft HGT (2).
4	Airspace class	D.
5	Unit Language	ASTURIAS TWR. ES/EN.
6	Transition altitude	-
7	Hours of applicability	-
8	Remarks	(1) Or the ground visibility, whichever is lower. (2) Or up to the cloud ceiling, whichever is lower.

LEAS AD 2.18 AIR TRAFFIC SERVICES COMMUNICATION FACILITIES

Service	Call sign	FREQ	HR	Remarks
APP	Asturias APP	118.150 MHz	HR ATS	APP/L
TWR	Asturias TWR	118.150 MHz	HR ATS	-
		121.500 MHz	HR ATS	EMERG
		243.000 MHz	HR ATS	EMERG
		121.705 C	HR ATS	GMC

LEAS AD 2.19 RADIO NAVIGATION AND LANDING AIDS

Facility (VAR)	ID	FREQ	HR	Coordinates	DME ELEV	Remarks
Facility (VAR)	ID	FREQ	HR	Coordinates	DME ELEV	Remarks
DVOR (0°)	VES	112.400 MHz	H24	433325.4N 0060025.5W	-	Possible signal loss in R-174. No signal in R-174 BTN ROVAK and 73.0 NM VES BLW FL200. R-252 COV FL095 52 NM, FL120 63 NM.
DME	VES	CH 71X	H24	433325.5N 0060026.4W	120 m	Possible signal loss in R-174 and R-040. No signal in R-174 BTN ROVAK and 73.0 NM VES BLW FL200. R-252 Possible signal loss FM 43 NM.
LOC 29 (0°) ILS CAT III	AVS	110.100 MHz	H24	433401.5N 0060258.1W	-	288° MAG/160 m FM THR 11; COV 25 NM AVBL at 3500 ft AMSL or ABV.
GP 29	-	334.400 MHz	H24	433344.3N 0060128.6W	-	3°; RDH 16.6 m; at 289 m FM THR 29 & 116 m FM RCL to the right in direction APCH.
ILS/DME 29	AVS	CH 38X	H24	433344.5N 0060128.5W	129 m	REF DME THR 29. COV 17 NM (15.9 DME) at 3000 ft or ABV AVBL BTN -24° & +35° FM RCL.
NDB (0°)	AV	387.000 kHz	H24	433220.7N 0055549.9W	-	COV 40 NM.

LEAS AD 2.20 LOCAL AERODROME REGULATIONS

For reasons of apron capacity, all air taxi, school and other General Aviation flight operations must request prior authorization from:

- Oficina de Operaciones LEAS
 - TEL: +34-985 127 531; 532
 - FAX: +34-985 545 109
 - AFTN: LEASYFYX
 - E-mail: operaciones_ovd@aena.es

Providing the following information:

- Name of the operator.
- Origin, date, ETA and aircraft identification.
- Destination, date, ETD and aircraft identification.
- Type of aircraft.
- Flight rules: VFR/IFR.

State, ambulance and hospital flights are exempt from this authorization. VFR/IFR flights without this prior authorization will not be permitted by the aerodrome.

20.1 ILS CATEGORY II AND III OPERATIONS

RWY 29, subject to service availability of the appropriate approach and landing aids, is suitable for carrying out CAT II and III operations by those air operators whose operational minima have been approved by the aeronautical civil authority.

20.2 HELICOPTER OPERATIONS

20.2.1 APPROACH

In VMC conditions, arriving traffic will comply with the visual approach chart VAC in force. They will proceed to the appropriate compulsory reporting visual points and they will request instructions from ATC.

In IMC conditions, they will comply with the published standard instrument arrival charts in force, following ATC instructions.

20.2.2 FINAL APPROACH

Helicopters shall approach aligned with the runway.

Under VMC conditions, unless otherwise indicated by ATC, they must complete the final approach on the runway.

In the cases indicated below, helicopters may complete the final approach on the parallel taxiway, on the straight segment of T parallel to runway between the runway-holding position T-1 and B for approaches by RWY 29, and on the segment of T between A and B for approaches by RWY 11 (see AD 2-LEAS ADC):

- Traffic with operational letter of exemption.
- Emergency operations.
- With exceptional ATC clearance, due to weather conditions or other operational needs which require this to reduce risks.

When the helicopter maximum length is larger than 23 m, the final approach will be carried out along the runway in any case.

In the event of simultaneous operations on the runway or taxiing on the apron, the final approach along the parallel taxiway shall not be cleared by ATC.

When their final approach is completed, helicopters with wheel landing gear will carry out touchdown at the same location to then proceed to ground taxiing (unless ATC should clear air taxiing due to operational needs).

When their final approach is completed, helicopters with skid landing gear will attain hovering in order to carry out air taxiing thereafter.

Under IMC conditions, helicopters must perform the final approach on the runway in any case, in accordance with the instrument approach procedures in force, following ATC instructions.

20.2.3 PARKING

Helicopters will follow the indications of the "FOLLOW ME" vehicle to be guided to the stand.

The helicopter parking positions shall be those identified as general aviation stands AG03 and AG05, which shall be accessed, unless otherwise indicated by ATC, by taxiing via TWY T and B.

Ground taxiing on the apron is mandatory for wheel-equipped helicopters.

When the air taxiing is completed, the helicopters with skid landing gear will carry out touchdown on the assigned location in the stand.

Simultaneous operations for helicopters on the apron are not allowed, without specific authorization.

20.2.4 TAXIING

Helicopter taxiing will be carried out via the taxiways and service roads marked on the apron to the stand.



In this regard, helicopter parking stands AG03 and AG05 are considered taxi-through stands.

Ground taxiing on the apron is mandatory for wheel-equipped helicopters.

Unless otherwise indicated by ATC, helicopters will access the parking apron via TWY B and will exit via TWY B to T.

20.2.5 LIFT-OFF

Helicopters with skid landing gear will carry out lift-off on the stand and, when they attain hovering, they will begin taxiing to the exit.

Helicopters with wheel landing gear will carry out the lift-off prior to take-off.

20.2.6 TAKE-OFF

Under VMC conditions, take-off shall be performed on the runway.

In the cases indicated below, helicopters may take off from the parallel taxiway, from the straight segment of T parallel to the runway between the runway-holding position T-1 and B or from the segment between A and B (see AD 2-LEAS ADC):

- Traffic with operational letter of exemption.
- Emergency operations.
- With exceptional ATC clearance, due to weather conditions or other operational needs which require this to reduce risks.

In the event of simultaneous operations on the runway or taxiing on the apron, take-off on the parallel taxiway shall not be cleared by ATC.

Should the maximum length of the helicopter be greater than 23 m, take-off shall be performed on the runway in all cases.

In IMC conditions, the departure will comply with the published standard instrument departure charts in force, following ATC instructions.

20.2.7 OVERFLIGHTS

Within the airport area, overflight is not allowed above:

- Buildings: terminal building, control tower, etc.
- Vehicle parkings areas.
- Fuel storage areas.
- Handling equipments areas.
- Other aircraft.

20.3 STANDARD TAXIING PROCEDURES

The West configuration (RWY 29) will be preferential, operating according to the appropriate assignment, except when the meteorological conditions establish another runway in use (RWY 11), or with ATC clearance.

Pilots, who request the use of a runway different from the appropriate assignment described above, shall be responsible for the possible delays.

All aircraft, which overshoot the exit taxiways C and D in landing, shall taxi to the runway end and vacate it via TWY T.

Aircraft of category L (light) are excluded from this restriction, subject to ATC clearance.

Take-off from RWY 11 and RWY 29 from the intersection with TWY C is authorized, except during LVC.

Pilots in command of departing aircraft, on reaching the runway-holding position of the runway in use, shall have carried out their previous checks and shall be ready to line up and begin the take-off run immediately after receiving the appropriate clearance. Aircraft which for any reason can not comply with this requirement, will notify this fact to ATC before reaching the holding position.

Regarding allocation of taxiing routes and entrance/exit gate to apron, according to the runway in use and except for operational reasons to the contrary (compliance with CTOT, pilot requesting opposite runway, direction of push-back/towing depending on aircraft taxiing on apron, incidents on apron, etc.), where ATC may coordinate the use of the opposite entrance/exit gate with TOAM/CECOPS, the aircraft assigned PRKG 1, 2 and 3 shall enter and exit the apron by TWY A, and aircraft assigned PRKG 4, 5, 6, 7, 8, and AG shall enter and exit the apron by TWY B.

On the basis of these procedures, the following taxiing routes are established (see AD 2-LEAS ADC):

Arrivals to RWY 11:

- RWY 11-ARR01: TWY T, A to PRKG 01, 02, 03.
- RWY 11-ARR02: TWY T, B to PRKG 04, 05, 06, 07, 08, AG.
- RWY 11-ARR03: TWY C, A to PRKG 01, 02, 03.
- RWY 11-ARR04: TWY C, T direction T-1, B to PRKG 04, 05, 06, 07, 08, AG.

Departures from RWY 11:

- RWY 11-DEP01: from PRKG 01, 02, 03 to TWY A, T to the holding point T-2.
- RWY 11-DEP02: from PRKG 04, 05, 06, 07, 08, AG to TWY B, T to the holding point T-2.

Departures from RWY 11 INT C:

- RWY 11-DEP03: from PRKG 01, 02, 03 to TWY A, T to the holding point C-1.

- RWY 11-DEP04: from PRKG 04, 05, 06, 07, 08, AG. to TWY B, T to the holding point C-1.

Arrivals to RWY 29:

- RWY 29-ARR01: TWY T, A to PRKG 01, 02, 03.
- RWY 29-ARR02: TWY D, T, A to PRKG 01, 02, 03.
- RWY 29-ARR03: TWY C, A to PRKG 01, 02, 03.
- RWY 29-ARR04: TWY T, B to PRKG 04, 05, 06, 07, 08, AG.
- RWY 29-ARR05: TWY D, T, B to PRKG 04, 05, 06, 07, 08, AG.
- RWY 29-ARR06: TWY C, T direction T-1, B to PRKG 04, 05, 06, 07, 08, AG.

Departures from RWY 29:

- RWY 29-DEP01: from PRKG 01, 02, 03 to TWY A, T to holding point T-1.
- RWY 29-DEP02: from PRKG 04, 05, 06, 07, 08, AG to TWY B, T to holding point T-1.

Departures from RWY 29 INT C:

- RWY 29-DEP03: from PRKG 01, 02, 03 to TWY A, T to holding point C-1.
- RWY 29-DEP04: from PRKG 04, 05, 06, 07, 08, AG. to TWY B, T to holding point C-1.

Unless otherwise indicated by ATC, in each case the established taxiing route to be used shall correspond to the:

- Runway in use.
- Requirements of take-off length (departure taxiing route).
- Requirements of landing length (arrival taxiing route).
- Pilots in command of the arriving aircraft will vacate the runway as soon as possible after touchdown in order to make maximum use of runway capacity, to lessen the occupancy time and to avoid missed approach manoeuvres, and without detriment to the safety and normal operation of the aircraft.
- All surface movements of aircraft, towed aircraft, persons and vehicles in the manoeuvring area are subject to prior ATC clearance.
- Assigned stand.

Aircraft shall follow the indications of the "FOLLOW ME" vehicle to be guided to the assigned stand, depending on operational criteria.

During LVP and at night, mandatory guidance by TOAM shall be provided for departures from general aviation parking stands on the apron.

Simultaneous operations of entry to/exit from stands will not be carried out in contiguous stands.

Simultaneous aircraft operations on Stand 8 and the general aviation stands, AG, are not permitted.

Entry-to and exit-from stand manoeuvres shall be carried out at a close to idling power. If a significant power increase is required, pilots shall contact ATC and the manoeuvre will be carried out under the supervision of a signalman.

All movements of aircraft, towed aircraft, persons and vehicles on the apron shall be regulated by the Apron Safety Regulations.

Collision avoidance with other aircraft or obstacles is responsibility of:

- Pilots taxiing in the apron and in the areas not visible from TWR.
- Ground handling agents during exit manoeuvring from the stand.

20.4 OPERATION OF TRANSPONDER IN MODE S WHEN THE AIRCRAFT IS ON THE GROUND

To enable cooperation with the Mode-S based Advanced Surveillance System, aircraft operators intending to use Asturias airport shall ensure that their transponders are able to operate in Mode S when the aircraft is on the ground.

Pilots shall:

Select AUTO Mode and the assigned Mode A code. If AUTO mode is not available, select ON (i.e. XPDR) and the assigned Mode A code:

- From the request for towed push-back or taxiing, whichever is earlier.
- After landing, continuously until the aircraft is fully parked on stand.
- When fully parked on stand, select STBY.
- Whenever the aircraft is capable of reporting Aircraft Identification (i.e. callsign used in flight), this should also be entered (through the FMS or the Transponder Control Panel) from the moment of request for towed push-back or taxiing, whichever is earlier. Air crew must use the ICAO defined format for entry of the Aircraft Identification (i.e. BAW123, AFR6380, ...).

To ensure that the performance of systems based on SSR frequencies (including airborne TCAS units and SSR radars) is not compromised, TCAS should not be selected before receiving the clearance to line up. It should then be deselected after vacating the runway.

For aircraft taxiing without flight plan, Mode A code 1000 should be selected.

20.5 PROCEDURE FOR THE REQUEST OF RESCUE PROTECTION LEVEL AND FIRE FIGHTING CATEGORY ON DEMAND

An operator wishing to operate at Asturias Airport with an aircraft of category ICAO-SSEI higher than 7 shall apply to the airport via email at: operaciones_ovd@aena.es, as far in advance as possible of the scheduled arrival date indicating the aircraft model and the scheduled time of arrival.

20.6 OPERATIONAL PROCEDURES FOR AIRCRAFT OF CODE LETTERS D AND E

20.6.1 GENERAL

The risk analyses undertaken have accredited that Asturias Airport offers sufficient guarantees of the level of operational safety required for the operation on the apron of all code letter D aircraft and those code letter E aircraft whose size and characteristics in terms of the physical infrastructure required for their manoeuvres and operations do not exceed those of the model A330-300.

When a code letter D aircraft is moving through the East or West zone of the Movement Area, the movement of more than one aircraft in the same zone shall not be permitted, the dividing line between the East and West zones of the Movement Area being understood to be the centre line perpendicular to the runway which runs along TWY B.

In the case of code letter E aircraft, simultaneous operation on the runway/taxiing is limited to one aircraft at a time.

The operation of aircraft exceeding the aerodrome's certified design characteristics is permitted during the application of LVP, and the directives described under the local procedure must also be observed.

It is necessary for code letter D or E aircraft to employ oversteering to enter or exit the apron via access gate B.

20.6.2 PARKING

The autonomous PRKG 08A on the apron has been defined for code letter aircraft (D and E), and its use is incompatible with that of the PRKG 07 and 08.

During the manoeuvres of parking and exit, use of the common ESA (Equipment Staging Area) for PRKG 06 and 07 shall be prohibited.

The movement of vehicles via the section of service road adjacent to apron PRKG 08A is not permitted during entry and exit manoeuvres for aircraft exceeding the aerodrome's certified design characteristics.

20.6.3 GROUND MOVEMENT

The power permitted on the apron is limited, with idling being established for taxiing on the apron.

1. Arrivals:

- RWY 29.- Exit runway via TWY T, taxiing via the parallel TWY T, up to apron access gate B, the taxiway via which aircraft shall access the apron towards the stand defined, taxiing via the access taxiway to the stand.
- RWY 11.- Exit runway via TWY T, taxiing via the parallel TWY T, up to apron access gate B, the taxiway via which aircraft shall access the apron towards the stand defined, taxiing via the access taxiway to the stand.

- If a pilot issues a specific request to ATC, guidance can be given with a "FOLLOW ME" vehicle to an arriving aircraft up to the corresponding apron gate. Obligatory guidance from apron access gate B up to aircraft stand.

1. Departures:

- RWY 29.- Exit from apron via B, taxiing via TWY T direction T-1 up to THR 29.
- RWY 11.- Exit from apron via B, taxiing via TWY T direction T-2 up to THR 11.
- If a pilot issues a specific request to ATC, guidance can be given with a "FOLLOW ME" vehicle to a departing aircraft, from the parking stand to the requested point of the manoeuvring area. Obligatory guidance from parking stand up to apron access gate B.

20.7 NIGHT VISUAL OPERATIONS (VFR-N)

VFR-N flights are permitted.

20.8 OPERATIONAL SAFETY REPORTS

Pilots/operator shall report to the airport as soon as possible, any accidents, incidents, occurrences or events which may have a potential operational impact and which they have been involved in or have witnessed.

The aim of these reports is the compilation of information in order to improve operational safety, independently of the mandatory reporting of the occurrence to the appropriate aeronautical authority. Data may be sent in any format, including at least the following information:

- Date and time.
- Site.
- Parties involved (data used to identify vehicles, aircraft...involved).
- Companies implicated.
- Description of the facts.
- Any other data considered relevant (e.g. lighting conditions, weather, phase of the operation such as takeoff / landing / stopover, pavement conditions...).

The contact e-mail address of the airport, for the reception of operational safety reports, is the following: seguridad_operacional_ovd@aena.es

In addition to notifying the airport by means of the indicated system, it is necessary to send at least basic data of the accident, incident, occurrence or event to the air traffic control service provider (ATC).

On the specific instance of safety reports related with the air traffic control service provider (manoeuvring area, flight phases and ATS airspace) these may be sent to the e-mail address: lecm.safety@enaire.es

LEAS AD 2.21 NOISE ABATEMENT PROCEDURES

No.

LEAS AD 2.22 FLIGHT PROCEDURES

22.1 VISUAL DEPARTURE PROCEDURE FOR IFR FLIGHTS

IFR flights may request a "visual departure" from ATC, on the ground or in the air, under the following conditions:

- Between the beginning of civil twilight in the morning and the end of civil twilight in the evening.
- Weather conditions in the direction of take-off and subsequent initial climb that allow visual flight up to the Minimum Sector Altitude (MSA), which will be provided by ATC.
- In the air, the pilot will propose a heading or a direct route to ATC.
- On the ground, the pilot will propose a heading or point to ATC, or ATC will propose a visual departure subject to the pilot's consent and readback.

- The pilot will be responsible for maintaining the obstacle clearance margin up to the Minimum Sector Altitude (MSA).

22.2 FLIGHT PROCEDURES FOR AIRCRAFT WITHOUT RNAV1 OPERATIONAL CLEARANCE

1. ARRIVALS PROCEDURE

Aircraft without RNAV1 operational clearance shall notify LECM of this condition on initial callup when entering FIR and they will receive ATC instructions to proceed to AMAKA or XONDA.

- Procedure in case of communications failure during arrival.

Traffic with communications failure shall proceed as follows: maintain last cleared level/altitude, proceed directly to AMAKA or XONDA, and from there, proceed to DVOR/DME VES and join holding. Start descending after one complete holding pattern or after the EAT if received, whichever is later, complete a published IFR approach to the active runway for arrivals, and land within the next 30 minutes.

1. DEPARTURES PROCEDURE

- Aircraft without RNAV1 operational clearance in initial call with LEAS shall will be cleared via conventional SID to proceed to AMAKA or XONDA as directed by ATC.
- Procedure in case of communications failure during departure.
- Traffic with communications failure shall proceed as follows: Head as directly as possible to AMAKA or XONDA climbing to the last cleared altitude/level or until the minimum safe altitude, whichever is higher; maintain that altitude or level for 7 minutes, afterwards, continue climbing according to the updated FPL and join the corresponding ATS route.

22.3 LOW VISIBILITY PROCEDURES (LVP)

22.3.1 GENERAL

- RWY 11 is authorized for low visibility take-offs (LVTO). RWY 29, equipped with ILS, is authorized for CAT II/III precision approaches and for low visibility take-offs.
- Once LVP are in place, the crew may request ATC for a guided take-off from Runway 29, provided that the ILS LOC is not downgraded.
- Low visibility procedures (LVP) shall be applied when any of the following conditions is met:
 - When any transmissometer indicates RVR equal to or lower than 800 m, or visibility equal to or lower than 800 m in the case of failure of all the transmissometers, or
 - Cloud ceiling equal to or lower than 300 ft (90 m).
- ATC shall inform pilots by radiotelephone that low visibility procedures are being applied. Any incident notified or detected which might affect the LVP shall be communicated immediately to the aircraft so that they can take appropriate measures.
- ATC shall supply the values of the runway visual range (RVR) directly, as follows:
 - RVR TDZ: Reading corresponding to the touchdown zone.
 - RVR MID: Reading from the runway midpoint.
 - RVR END: Reading from the runway end.
- When CAT II/III approaches are performed, permission to land shall be conceded before the aircraft is at 2 NM from the TDZ and will only be issued once the sensitive areas (LSA) of the ILS are clear.
- The LVP shall be cancelled when all of the following conditions are met:
 - When all the transmissometers indicate RVR above 1000 m, or the same value of visibility if the transmissometers are out of service, and
 - Cloud ceiling higher than 500 ft (150 m).

22.3.2 GROUND MOVEMENTS

While LVPs are active, only taxiing of one single mobile unit (aircraft, vehicle or aircraft-vehicle group, vehicle-vehicle under guidance, towing or checking of the manoeuvring area) is permitted in the manoeuvring area, and only one aircraft on the apron is

permitted.

While the LVP are active, TWY C shall be closed. Pilots shall proceed to verify the situation of their aircraft at all times, especially at intersections, ensuring that their taxiing takes place under conditions of complete operational safety.

If a pilot issues a specific request to ATC, guidance can be given with a "FOLLOW ME" vehicle on arrival to the corresponding gate on the apron. Obligatory guidance from apron access gate to parking stand.

If a pilot issues a specific request to ATC, guidance can be given with a "FOLLOW ME" vehicle to a departing aircraft from the parking stand to the requested manoeuvring area point.

In the event that an exiting aircraft has to return to the apron, the pilot shall inform ATC and await new taxiing instructions.

With the LVP active, the same requirements and physical restrictions on taxiways and on the apron for aircraft exceeding the aerodrome's certified design characteristics (see item 20. LOCAL REGULATIONS – OPERATIONAL PROCEDURE FOR AIRCRAFT OF CODE LETTERS D AND E).

22.3.2.1 Arrivals

On vacating RWY 29, pilots shall notify:

- a) ILS sensitive area clear and,
- b) Exit taxiway used.

The ILS sensitive area becomes vacant when the centre line lights of the taxiway used change from green and yellow to all green.

On the apron, pilots shall notify:

- a) Stand assigned to the aircraft and,
- b) Frequency out.

Any aircraft that overshoots TWY D in landing on RWY 29 shall continue taxiing to the runway end to vacate it via TWY T.

22.3.2.2 Departures

Pilots shall notify the start of taxiing towards TWY A or B (as indicated by ATC).

22.3.3 COMMUNICATIONS FAILURE AND ANOMALOUS SITUATIONS IN THE MANOEUVRING AREA.

22.3.3.1 Communications failure

In the event that an aircraft operating in the manoeuvring area should experience a communications failure, it shall proceed as follows:

- Departing aircraft: the aircraft shall continue by the assigned route and halt at the ATC clearance limit, taking extreme care, where it shall hold and await the arrival of an assistance vehicle.
- Arriving aircraft: if the aircraft has just landed, it shall hold on vacating the sensitive area and await the arrival of an assistance vehicle.

If the aircraft already has ATC taxiing clearance, it shall continue by the assigned route and halt at the ATC clearance limit, taking extreme care, where it shall hold and await the arrival of an assistance vehicle.

22.3.3.2 Anomalous situations in the manoeuvring area

1. Uncertainty about position in the manoeuvring area.

- Other than as provided for in the following paragraph, if a pilot is in doubt about the position of the aircraft in relation to the manoeuvring area, they must immediately halt the aircraft and report this circumstance to ATC (including the last known position).
- In situations in which a pilot is in doubt about the position of the aircraft in relation to the manoeuvring area, but recognises that the aircraft is on a runway, the pilot shall immediately report this to ATC (including the last known position), and vacate the runway as soon as possible, if they can find an appropriate taxiway nearby, unless ATC should indicate otherwise, and then, halt the aircraft.
- In the event that ATC realises that an aircraft or vehicle has lost its position in the manoeuvring area, or is not sure of its position, the appropriate measures shall be taken immediately to safeguard the operations and help the aircraft or vehicle in

question to determine its position.

1. Loss of visual contact between mobile elements

- In the event that one aircraft loses visual contact with another, or with a vehicle with which it is maintaining its own separation, ATC shall be informed immediately, and the aircraft halted. ATC shall take the measures that it shall deem fit.

1. Breakdown of aircraft

- It shall report the situation to ATC and await the arrival of assistance. Should it find itself on a runway, if possible and unless ATC should indicate otherwise, this shall be vacated.

22.3.4 CAT II/III PRACTICE APPROACHES

1. ATC shall not authorize CAT II/III precision practice approaches when the visibility is equal to or less than 1000 m or the cloud ceiling is equal to or less than 500 ft (150 m).
2. Those aircraft wishing to carry out this kind of approach shall communicate this to ATC as soon as possible so that the appropriate measures can be taken.

22.3.5 AIRCRAFT ON TAKE-OFF

Take-offs with RVR below 125 m are permitted. It is compulsory to comply with Requirement AMC1 SPA.LVO.100(a) of Regulation (EU) 965/2012 of 5 October 2012 laying down technical requirements and administrative procedures related to air operations, which states in Section (e) that low visibility take-off operations are not permitted when RVR<75m, and therefore no operations shall be conducted under these conditions.

Guided take-offs are permitted on RWY 29 provided the requirements of AMC1 ADR are met. OPS.B.045(a)(1). Aircraft shall notify ATC as soon as possible if they require a guided take-off.

22.4 ATS SURVEILLANCE SYSTEM

ATS surveillance systems may be used in the provision of the aerodrome control service, to perform the following functions:


1. Flight path monitoring of aircraft on final approach;
2. Flight path monitoring of other aircraft in the vicinity of the aerodrome;
3. Establishing the separation specified in article 4.6.7.3 of the R.C.A between consecutive departing aircraft;
4. Providing navigation assistance to VFR flights.

The provision of functions b) and d) is not guaranteed neither in the ATZ below 500 ft AMSL, nor in the south half of the ATZ below 1600 ft AMSL. Depending on the availability of ATS surveillance systems, the altitude from which the preceding functions (a), b), c) and d)) can be provided may be affected or they may even be suspended, in this case, this will be notified to the aircraft by the available aeronautical information resources.

22.5 CONTINUOUS DESCENT OPERATIONS

Depending on traffic situation, and if no need for interrupting the descent is foreseen, aircraft will be cleared to proceed to a standard arrival (STAR), or by means of a "direct to" clearance to an intermediate fix of the STAR, to the IAF, to an intermediate approach fix or to the IF, to the adequate altitude of the instrumental procedure (IAC), in order to allow a continuous descent operation.

22.6 AD TRAFFIC CIRCUIT

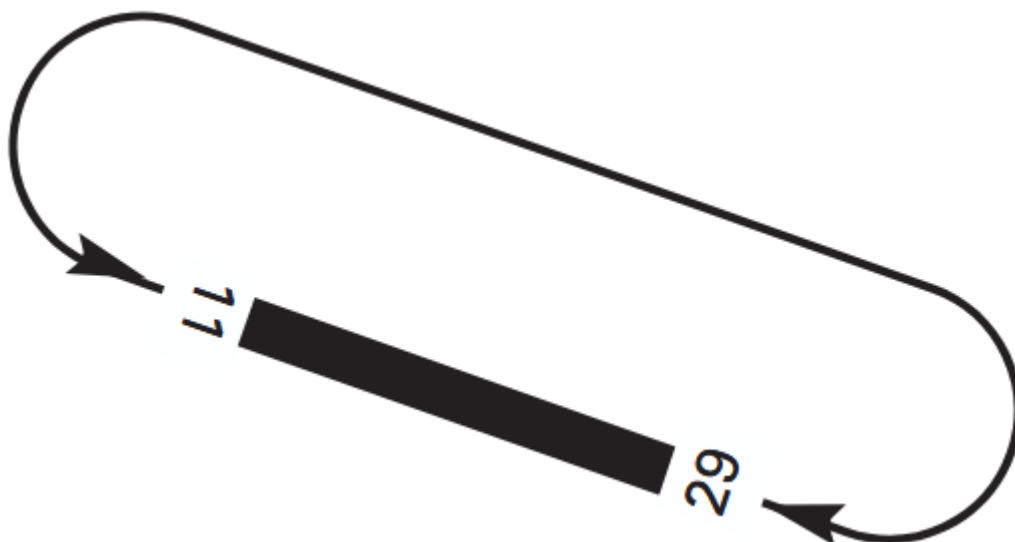

LEAS AD 2.23 ADDITIONAL INFORMATION

High probability of unpredicted fog.

23.1 BIRD CONCENTRATION AREAS


Birds presence in and near the airport is probable. Caution is therefore recommended, especially under adverse meteorological conditions and with North wind.

Between approximately 15 June and 15 September, with greatest likelihood during the months of July and August, after days of rain, with stable environmental conditions, high humidity and temperature, and in the absence of rain and wind, there may be occasional concentrations of yellow-legged gulls (*Larus michahellis*), due to the massive presence of flying ants over the runway at altitudes between 0 and 500 metres (higher when there is low pressure).

FLOWS OF BIRDS

Between the months of October and March, coinciding with the winter and migratory periods, and especially associated with the occurrence of adverse weather (sea storms, cold waves), there may be concentrations of flocks of wading birds (European lapwing, European golden plover) in the airport grounds, with preferential use of paved areas in the Airport Operational Safety Zone.

1. Yellow-legged gull (*Larus michahellis*).
2. Small birds of prey, mainly common buzzard (*Buteo buteo*) and common kestrel (*Falco tinnunculus*).

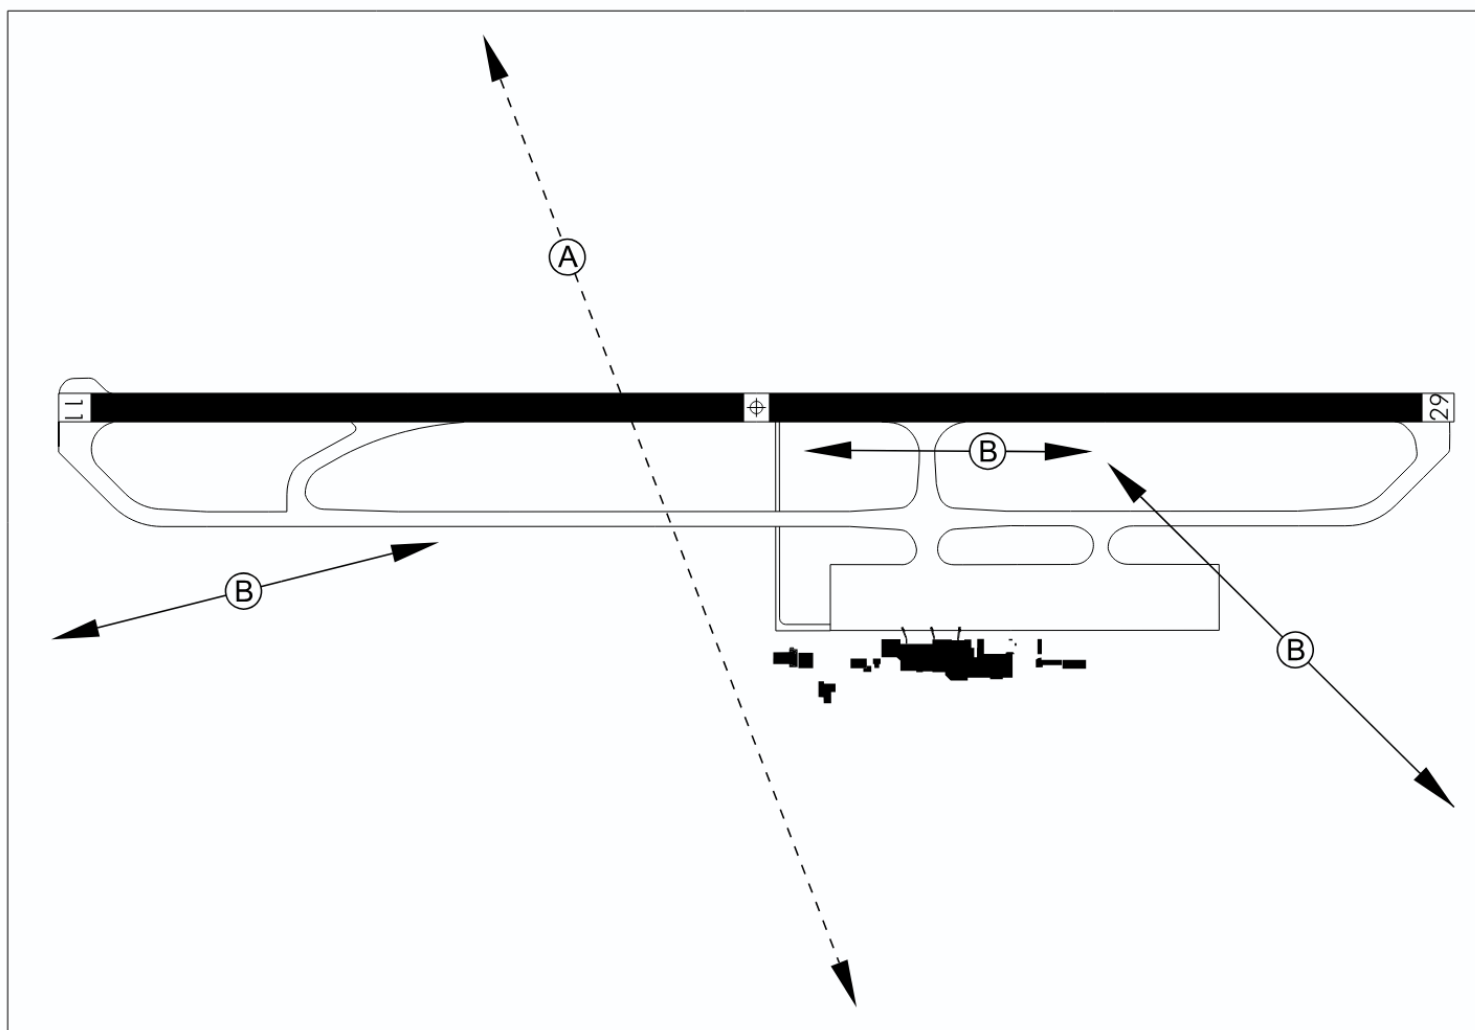

LEAS AD 2.24 AERONAUTICAL CHARTS RELATED TO AN AERODROME

The list of charts related to the aerodrome can be found on the link below:

aip.enaire.es/AIP/#LEAS

LEAS AD 2.25 VISUAL SEGMENT SURFACE (VSS) PENETRATION

Not applicable.